



# Service Bulletin

American Honda Motor Co., Inc.

## 2001-2002 GL1800A ABS Speed Sensor Wire Clamp Location

If the speed sensor wire clamp for the front ABS speed sensor is installed incorrectly, the ABS speed sensor air gap may be out of specification. This does not affect ABS speed sensor operation, but the clamp should be installed correctly.

Inspect and repair all affected units using the Inspection/Repair procedures listed below. Inspect all unsold units and customer units brought in for service.

### AFFECTED UNITS

2001-2002 GL1800A units as follows:

#### MODEL

2001 GL1800A

**All units**

2002 GL1800A

**1HFSC474\*2A100001 – 1HFSC474\*2A101643**

\* = denotes check digit


Any unit in the above VIN range **may** be affected and should be inspected according to the procedures in this Service Bulletin. All units outside of the above VIN range do not require inspection.

### CUSTOMER NOTIFICATION


There is **no customer notification** associated with this Service Bulletin.

### INSPECTION/REPAIR PROCEDURES

1. If the VIN is within the preceding range, inspect the front ABS speed sensor wire clamp according to the following illustrations.

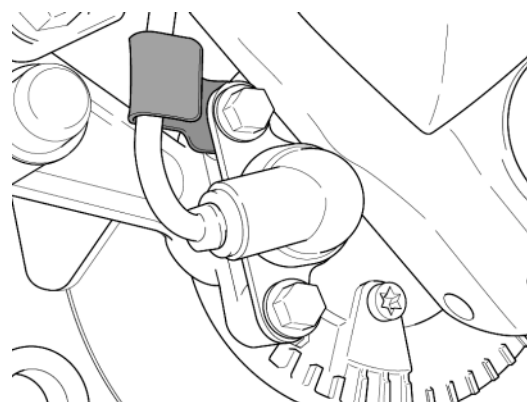

**INCORRECT Installation**

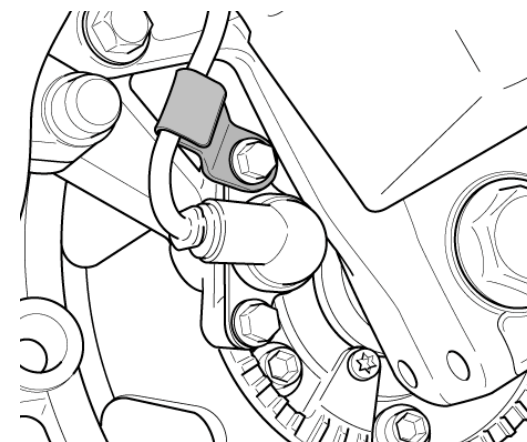

**CORRECT Installation**

2. If the clamp is installed correctly on **top** of the speed sensor, no further action is necessary.

3. If the clamp is installed incorrectly **under** the speed sensor, remove and reinstall the clamp and speed sensor correctly. Torque the bolts,.

**Torque: 12 N•m (1.2 kgf•m, 9 lbf•ft)**

**GL1800 #9  
DECEMBER 2001**

**IDENTIFICATION**

There is **no identification mark** associated with this Service Bulletin.

**PARTS INFORMATION**

There is **no parts information** associated with this Service Bulletin.

**WARRANTY INFORMATION**

The normal warranty claim submission requirements apply. Submit one warranty claim per VIN with the following information only:

**Inspected and REPAIRED**

Template: **GL#9**

Hours: **0.2 hours**

Parts: **None**